

**COUNTY OF LOS ANGELES**

**ROAD DEPARTMENT**



**MALIBU QUAD**

**BENCH MARKS**

**1960**

## PREFACE

The Road Department level net is composed of more than 1,000 miles of levels supporting in excess of 10,000 bench marks. In 1964-65, a major readjustment of the net was undertaken. To emphasize the complete break with previous elevations, the SY, SG & SL series bench marks have been re-labeled BY, BG & BL, respectively.

To facilitate the adjustment, indexing, and distribution of adjusted values of the net, the County territory was divided into 31 quads or areas. For identification purposes each quad was given a name, viz., "Rosemead," "La Mirada," "Santa Fe," etc. When bench marks and elevations in the Road Department net are used, the name of the quad in which the bench mark is located and the date of the adjustment of the elevation must be included in the bench mark description, e.g.,

BG 1887 --L+BN IN CONC HDWL OF DRAIN PIPE UNDER DR 218 FT  
NE +18 FT SE C/L INT SAN JOSE HILLS RD +CAMERON AVE MKD (BM)  
( COVINA --1965) ELEV. 696.238

It is expected that this general adjustment will, for the most part, remain sound for the next 8 to 12 years. As new circuits are completed, however, re-adjustment of individual quads may become advisable. It is expected that these subsequent adjustments will be in the nature of a few hundredths of a foot. When a quad is re-adjusted, new elevation lists will be published and the date of the re-adjustment will replace the "1965" at the end of the bench mark description. Two bench marks in the same quad with different adjustment dates will not normally join each other. Since all adjustments taper out to nothing at the periphery of the quad, any bench mark in one quad will join any bench mark in another quad regardless of their respective adjustment dates.

The basic accuracy of the net is reflected by an indicated field probable error of plus or minus 0.012 foot per mile of leveling as determined from 298 conditions of closure. However, many years experience in vertical control in the greater Los Angeles basin and Antelope Valley indicate that because of varying degrees of subsidence and heaving, the true datum is recovered only by obtaining substantial agreement of a number of bench marks.

The users of this net are invited to assist in its maintenance by notifying this Department of cases of obliteration, apparent mistakes in descriptions or elevations, and proven disturbance of bench marks.

---


DATUM: U. S. Coast and Geodetic Survey Sea Level Datum  
of 1929, through the medium of the Los Angeles  
County Engineer Precise Level Net, 1963 Adjust-  
ment.

ABBREVIATIONS USED IN BENCH MARK LISTINGS

ABUT - - - - -	Abutment	EC - - - - -	End of Curve
ALG - - - - -	Along	ENT - - - - -	Entrance
ANG PT - - - - -	Angle Point	FL - - - - -	Floor
B/W - - - - -	Back of Walk	FTG - - - - -	Footing
BCR - - - - -	Beginning of Curb Return	F/W - - - - -	Front of Walk
BC - - - - -	Beginning of Curve	GAR - - - - -	Garage
BLDG - - - - -	Building	HDWL - - - - -	Headwall
BM - - - - -	Bench Mark	HSE - - - - -	House
BT SPK - - - - -	Boat or Bolt Spike	INT - - - - -	Intersection
BR CAP - - - - -	Brass or Bronze Cap	IP - - - - -	Iron Pipe
C B - - - - -	Catch Basin	LT - - - - -	Left
CTR - - - - -	Center	LACE - - - - -	L. A. City Engineer
C/L - - - - -	Center Line	LACS - - - - -	L. A. County Engineer
C/L INT - - - - -	Center Line Intersection	LAFC - - - - -	L. A. Co. Flood Control
C/L PROD - - - - -	Center Line Produced	L+BN - - - - -	Lead and Bench Nail
CONC - - - - -	Concrete	L+BR - - - - -	Lead and Brad
COR - - - - -	Corner	L+N - - - - -	Lead and Nail
COE - - - - -	Corps of Engineers	L+RDBM TAG - - - - -	Lead and Road Dept. Bench Mark Tag
CULV - - - - -	Culvert	L+SPK - - - - -	Lead and Spike
CB - - - - -	Curb	L+T - - - - -	Lead and Tack
CS MON - - - - -	County Engineer Monument	MCR - - - - -	Middle of Curb Return
CS BR CAP - - - - -	County Engineer Brass Cap	MKD - - - - -	Marked
CT SPK - - - - -	Cut Spike	MC - - - - -	Middle of Curve
DR - - - - -	Drive or Driveway	MON - - - - -	Monument
E/O - - - - -	East of	N/O - - - - -	North of
ECR - - - - -	End of Curb Return	NR - - - - -	Near

ABBREVIATIONS USED IN BENCH MARK LISTINGS . . . CONTINUED

OPP - - - - - Opposite  
PI - - - - - Point of Intersection  
PK+W - - - - - PK Nail and Washer  
P/L - - - - - Property Line  
POST - - - - - Point on Semi-Tangent  
PP - - - - - Power Pole  
PVMT - - - - - Pavement  
PROD - - - - - Produced  
RD - - - - - Road  
RDEM - - - - - Road Dept. Bench Mark  
RR - - - - - Railroad  
RT - - - - - Right  
R/W - - - - - Right of Way  
SDMH - - - - - Storm Drain Manhole  
SMH - - - - - Sewer Manhole  
SPK - - - - - Spike  
ST+W - - - - - Spike Tin and Washer  
S/O - - - - - South of  
TP - - - - - Telephone Pole  
USC+GS - - - - - U. S. Coast and Geodetic Survey  
USGS - - - - - U. S. Geological Survey  
WK - - - - - Walk  
W/O - - - - - West of

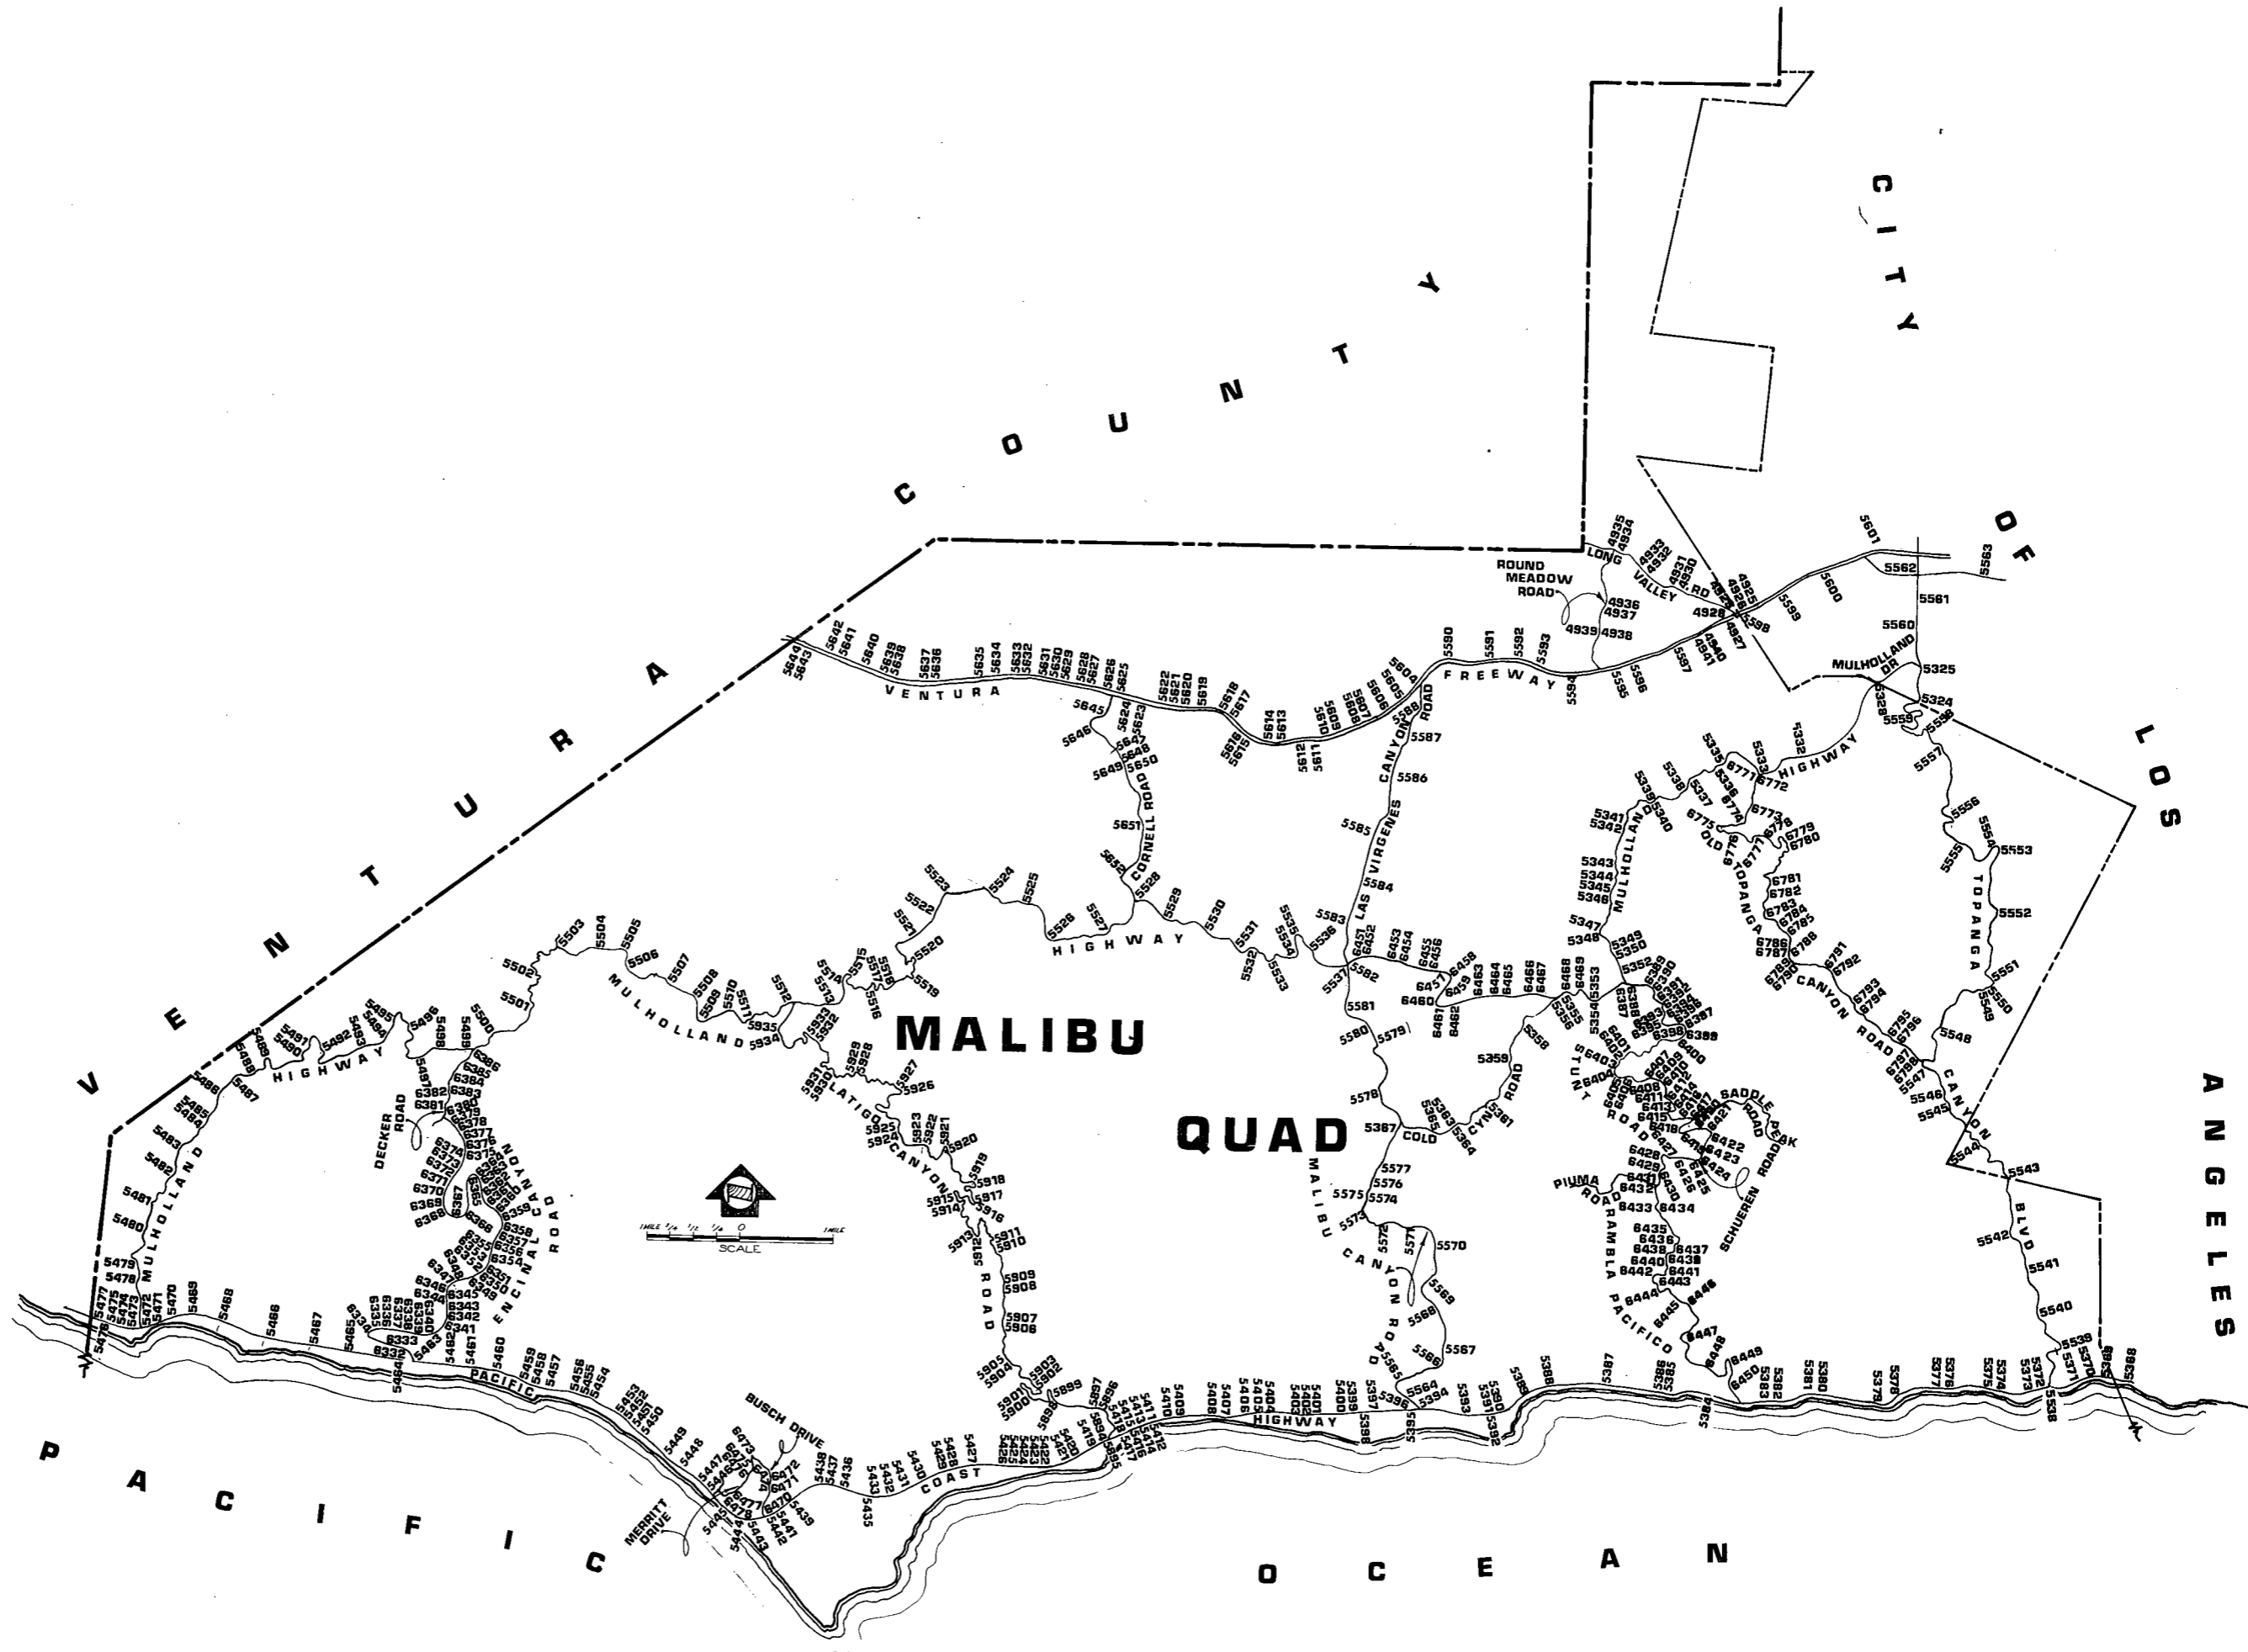

QUAD-YEAR	ELEV	DESCRIPTION (INCLUDE QUAD AND YEAR IN DESCRIPTION)	BM NUMBER
MALIBU (1960)	920.622	ST HWY MON IN WELL C/L LONG VALLEY RD (VENTURA FRWY N SERVICE RD) 90FT± W C/L VALLEY CIRCLE BLVD	SY 4925
MALIBU (1960)	922.452	RDBM TAG N CB LONG VALLEY RD (N SERVICE RD VENTURA FRWY) UNDER MULHOLLAND DR OVERCROSSING @ APPROX C/L MULHOLLAND DR	SY 4926
MALIBU (1960)	926.680	BR CAP C/L VENTURA FRWY 12IN DN 1200FT W MULHOLLAND DR OVERCROSSING	SY 4927
MALIBU (1960)	926.098	FLAG WIRE SPK N CB VENTURA FRWY N SERVICE RD 73FT W LONG VALLEY RD PROD FROM NW (ENT RD TO HIDDEN HILLS) 105FT N C/L VENTURA FRWY	SY 4928
MALIBU (1960)	920.634	RDBM TAG CONC CB 5FT± SE GUARD HSE @ ENT TO HIDDEN HILLS 2FT± N C/L LONG VALLEY RD (PRIVATE RD)	SY 4929
MALIBU (1960)	938.361	RDBM TAG E CB PARADISE VALLEY RD 5FT N CB RET @ NE COR LONG VALLEY RD 45FT N + 15FT E C/L INT 3.5MI± NW VENTURA FRWY	SY 4930
MALIBU (1960)	938.518	RDBM TAG N CB LONG VALLEY RD 5FT W CB RET @ NW COR PARADISE VALLEY RD 18FT± N + 45FT W C/L INT	SY 4931
MALIBU (1960)	973.684	RDBM TAG E CB HILLTOP RD 1FT S CB RET @ NE COR LONG VALLEY RD 45FT± N + 13FT± E C/L INT	SY 4932
MALIBU (1960)	973.668	RDBM TAG W CB HILLTOP RD 1FT± S CB RET @ NW COR LONG VALLEY RD 45FT± N + 13FT± W C/L INT	SY 4933
MALIBU (1960)	1029.286	RDBM TAG NR NE COR CONC SLAB @ HILLEN HILLS MUTUAL WATER CO WELL NO U8 40FT E C/L ROUND MEADOW RD + 95FT± S C/L LONG VALLEY RD	SY 4934
MALIBU (1960)	1030.821	L+T CONC WK TO HSE NO 24655 55FT E + 145FT N C/L INT ROUND MEADOW RD + WING FIELD RD	SY 4935
MALIBU (1960)	1104.194	L+T S EDGE CONC DRWY HSE NO 5404 ROUND MEADOW RD 21FT E C/L ROUND MEADOW RD + 185FT± N C/L HOBACK GLEN RD	SY 4936
MALIBU (1960)	1098.269	L+T E EDGE CONC DRWY S/S HSE NO 5404 ROUND MEADOW RD 20FT± N C/L HOBACK GLEN RD + 83FT± E C/L ROUND MEADOW RD	SY 4937
MALIBU (1960)	1102.132	RDBM TAG NW COR 30IN BY 30IN CONC SQUARE 40FT± E C/L ROUND MEADOW RD 20FT± N TRACT LINE (HIDDEN HILLS) 0.4 MI± N VENTURA FRWY	SY 4938
MALIBU (1960)	1107.666	RDBM TAG NE COR CONC SLAB 58FT W C/L ROUND MEADOW RD 12FT± N END PAVED RD @ TRACT LINE (HIDDEN HILLS) 0.4MI± N VENTURA FRWY	SY 4939
MALIBU (1960)	1094.980	RR SPK NE SIDE 30IN OAK TREE 6IN ABOVE GROUND 115FT± S C/L VENTURA FRWY 0.6MI± W MULHOLLAND DR	SY 4940
MALIBU (1960)	1090.980	ST HWY BR CAP 8IN DN ON VENTURA ON VENTURA FRWY C/L @ BC 0.6MI± W MULHOLLAND DR	SY 4941
MALIBU (1960)	1124.088	CS BR CAP 6IN ABOVE SURFACE IN 12IN CONC POST 4FT W TP NO 588165H ON N TOPANGA CANYON BLVD 1.5MI± S VENTURA BLVD NR MI MARKER (A-10.95MI) 50FT± SE C/L N TOPANGA CANYON BLVD MKD (BM 56-19 RE 5869 1960)	SY 5324

QUAD-YEAR	ELEV	DESCRIPTION (INCLUDE QUAD AND YEAR IN DESCRIPTION)	BM	NUMBER
MALIBU (1960)	1015.804	FD HEX BT IN LACE MON 10IN DN IN WELL ON APPROX C/L MULHOLLAND DR + C/L PROD TOPANGA CANYON BLVD TO THE S	SY	5325
MALIBU (1960)	1046.464	RDBM TAG E WINGWALL ROCK CULV 1FT S OF N END 160FT S APPROX C/L INT MULHOLLAND DR + MULHOLLAND HWY 0.5MI± W TOPANGA CANYON BLVD	SY	5328
MALIBU (1960)	1070.422	RDBM TAG @ SW COR CONC + ROCK CULV 25FT± N C/L MULHOLLAND HWY + APPROX 400FT W DECLARATION AVE	SY	5332/
MALIBU (1960)	1042.724	RDBM TAG CTR HDWL OVER DRAIN PIPE OF CULV 15FT± E APPROX C/L INT OLD TOPANGA CANYON RD + MULHOLLAND HWY 2FT E POST (408+38)	SY	5333
MALIBU (1960)	1104.117	RDBM TAG E WINGWALL CONC + ROCK CULV 4FT S OF END OF WINGWALL 20FT± S C/L MULHOLLAND HWY + 0.5MI± SW INT OLD TOPANGA CANYON RD + MULHOLLAND HWY TO THE N	SY	5335
MALIBU (1960)	1114.007	L+T CTR CONC + ROCK HDWL CULV 25FT± N C/L MULHOLLAND HWY + 0.6MI± SW INT OLD TOPANGA CANYON RD + MULHOLLAND HWY @ MARKER POST *328+31)	SY	5336
MALIBU (1960)	1191.016	RDBM TAG E CONC + ROCK HDWL 2FT± S OF N END 23FT± S C/L MULHOLLAND HWY + 540FT± E INT DRY CANYON COLD CR RD TO THE W 0.9MI± SW INT OLD TOPANGA CN RD + MULHOLLAND HWY	SY	5337
MALIBU (1960)	1197.255	RDBM TAG SE COR CONC WINGWALL CULV 20FT± NW C/L MULHOLLAND HWY + 200FT± E INT DRY CN COLD CR RD TO THE W + 1.0MI± SW INT OLD TOPANGA CN RD + MULHOLLAND HWY + 33FT± E HWY MARKER (355+32)	SY	5338
MALIBU (1960)	1279.418	RDBM TAG S CONC + ROCK WINGWALL CULV 20FT± W + 35FT± N APPROX C/L INT MULHOLLAND HWY + CANYON DR TO THE E 1.5MI± SW OLD TOPANGA CN RD	SY	5339
MALIBU (1960)	1285.853	RDBM TAG CTR CONC + ROCK HDWL CULV 32FT± E + 28FT± S APPROX C/L INT MULHOLLAND HWY + CANYON DR TO THE E NR HWY MARKER *333+90) 1.5MI± SW OLD TOPANGA CN RD	SY	5340
MALIBU (1960)	1458.554	RDBM TAG SE COR CONC EQUESTRIAN TUNNEL 15FT± N C/L DRY CN COLD CR RD 0.1MI± W C/L INT MULHOLLAND HWY + DRY CN COLD CR RD TO THE W NR HWY MARKER (102+55) (2.0MI± SW OLD TOPANGA CN RD)	SY	5341
MALIBU (1960)	1457.972	RDBM TAG CTR CONC + ROCK HDWL TO EQUESTRIAN TUNNEL 15FT± S C/L DRY CN COLD CR RD 0.1MI± W C/L INT MULHOLLAND HWY + DRY CN COLD CR RD TO THE W ACROSS RD FROM HWY MARKER (102+55) (2.0MI± SW OLD TOPANGA CN RD)	SY	5342
MALIBU (1960)	1394.080	RDBM TAG N WINGWALL CONC + ROCK CULV 15FT± E C/L DRY CN COLD CR RD ACROSS RD FROM HWY MARKER (83+36) +0.4MI± SW FROM C/L INT DRY CN COLD CR RD + MULHOLLAND HWY	SY	5343
MALIBU (1960)	1344.701	RDBM TAG N WINGWALL CONC + ROCK CULV 15FT± E C/L DRY CN COLD CR RD 0.65MI± SW FROM INT DRY CN COLD CR RD + MULHOLLAND HWY	SY	5344
MALIBU (1960)	1335.239	RDBM TAG N WINGWALL CONC + ROCK CULV 15FT± E C/L DRY CN COLD CR RD 0.65MI± SW FROM INT DRY CN COLD CR RD + MULHOLLAND HWY	SY	5345

QUAD-YEAR	ELEV	DESCRIPTION (INCLUDE QUAD AND YEAR IN DESCRIPTION)	BM NUMBER
MALIBU (1960)	1326.813	CS BM MON CONC BASE 6IN ABOVE SURFACE 28FT W C/L DRY CN COLD CR RD + 0.7MI± SW C/L INT OF DRY CN COLD CR RD + MULHOLLAND HWY MKD (BM 9M RE 2177) 25FT± SW HWY MARKER (68+13)	SY 5346
MALIBU (1960)	1235.344	RDBM TAG S WINGWALL OF CONC + ROCK CULV 15FT± E C/L DRY CN COLD CR RD + 1.25 MI± SW C/L INT DRY CN COLD CR RD + MULHOLLAND HWY	SY 5347
MALIBU (1960)	1213.405	RDBM TAG N WINGWALL CONC + ROCK CULV 15FT E C/L DRY CN C/LD CR RD + 1.26MI± SW C/L INT DRY CN COLD CR RD + MULHOLLAND HWY NR HWY MARKER (36+84)	SY 5348
MALIBU (1960)	1164.729	RDBM TAG N WINGWALL CONC + ROCK CULV 15FT± E C/L DRY CN COLD CR RD + 1.7MI± SW COL INT DRY CN COLD CR RD + MULHOLLAND HWY NR HWY MARKER	SY 5349
MALIBU (1960)	1152.297	RDBM TAG W WINGWALL CONC + ROCK CULV 15FT± N C/L DRY CN COLD CR RD + 1.8MI± S C/L INT DRY CN COLD CR RD + MULHOLLAND HWY 70FT± SE HWY MARKER (15+84)	SY 5350
MALIBU (1960)	1058.328	RDBM TAG N WINGWALL CONC + ROCK CULV 20FT± W C/L MULHOLLAND HWY 650FT S C/L INT DRY CN COLD CR RD TO THE W + MULHOLLAND HWY 10FT± S PP NO 1090729E 0.15MI± N STUNT RD	SY 5352
MALIBU (1960)	1028.131	RDBM TAG E WINGWALL 20FT± N + 65FT W C/L INT MULHOLLAND HWY + COLD CN RD TO THE SE NR HWY MARKER (198+01) 0.4MI± SW STUNT RD	SY 5353
MALIBU (1960)	1024.246	RDBM TAG CTR HDWL CONC + ROCK CULV 30FT± S + 70FT± W C/L INT MULHOLLAND HWY + COLD CN RD TO THE SE ACROSS FROM HWY MARKER (198+01) 0.4MI± SW STUNT RD	SY 5354
MALIBU (1960)	975.124	RDBM TAG NE WINGWALL CONC + ROCK CULV 20FT± SE C/L MULHOLLAND HWY 300FT± N C/L INT COLD CN RD + MULHOLLAND HWY 70FT± S TP NO 713575H 1.0MI± SW STUNT RD	SY 5355
MALIBU (1960)	964.114	CS BR CAP CONC POST 6IN ABOVE SURFACE 320FT± S C/L MULHOLLAND HWY 16FT± E C/L COLD CYN RD 1.0MI± SW STUNT RD 4FT± S PP NO 711130E MKD (BM M5H RE 329)	SY 5356
MALIBU (1960)	721.520	RDBM TAG CONC BOULDER 20FT± E C/L COLD CN RD 35FT± SE FROM HWY MARKER (75+30) 95FT SE FROM PP NO 711120E 0.6MI± S C/L INT COLD CN RD + MULHOLLAND HWY NR PRVT RD TO E	SY 5358
MALIBU (1960)	735.594	RDBM TAG IN S WINGWALL CONC + ROCK CULV 16FT± W C/L COLD CN RD 95FT± NW HWY MARKER (58+29) 80FT± N PP NO 711113E 1.0MI± S C/L INT COLD CN RD + MULHOLLAND HWY	SY 5359
MALIBU (1960)	631.138	RDBM TAG NR N END OF CULV CONC HDWL 18FT± E C/L COLD CN RD + 165FT± SE WONDerview DR 10FT± N HWY MARKER (32+71) 1.5MI± S MULHOLLAND HWY	SY 5361
MALIBU (1960)	609.553	RDBM TAG NR CTR CULV CONC HDWL 18FT W C/L COLD CN RD + 340FT± S WOODBLUFF DR NR HWY MARKER (7+31) 2.0MI± S MULHOLLAND HWY + COLD CN RD INT	SY 5363
MALIBU (1960)	612.038	RDBM TAG @ ANGLE PT IN CULV CONC HDWL 20FT± SE C/L COLD CN RD + 520FT± S WOODBLUFF DR NR HWY MARKER (5+53) 2.0MI± S MULHOLLAND HWY + COLD CN RD INT	SY 5364



QUAD-YEAR	ELEV	DESCRIPTION (INCLUDE QUAD AND YEAR IN DESCRIPTION)	BM NUMBER
MALIBU (1960)	460.188	SPK+W CTR CULV RUBBLE HDWL 12FT± NW C/L PIUMA RD + 300FT± E CRATER CAMP DR 0.4MI± E LAS VIRGENES RD NR HWY MARKER (321+36)	SY 5365
MALIBU (1960)	470.863	CS BM MON IN CONC ABUT @ NW COR BRIDGE NO B 989 MALIBU CN RD (LAS VIRGENES RD) 15FT± W C/L MALIBU CN RD + 180FT± S C/L PIUMA RD MKD (BM 57-13 1960RD 58 69)	SY 5367
MALIBU (1960)	40.030	LACE MON IN WELL 12IN BELOW SURFACE 26FT± S C/L PACIFIC COAST HWY 0.1MI± E LAC LIMITS 38FT±E OF W EDGE OF CONC STEPS TO BEACH 76FT± S OF W EDGE OF CONC RET WALL @ N CB MKD (TOPANGA CANYON E-7)	SY 5368
MALIBU (1960)	21.200	LACE HEX BAR IN WELL 18IN BELOW SURFACE C/L PACIFIC COAST HWY @ J. PAUL GETTY MUSEUM OPP DOOR TO BLDG NO 18002 52FT SE OF W END ROCK WALL + 37FT± SW OF SPK IN CATCH BASIN	SY 5369
MALIBU (1960)	19.292	CS TRAVERSE MON PACIFIC COAST HWY OPP W LINE HSE NO 18222 2FT± S OF N EDGE OF PVMT 58FT± N OF NW COR HSE MKD (D-8)	SY 5370
MALIBU (1960)	20.360	CS TRAVERSE MON PACIFIC COAST HWY 0.2MI± E TOPANGA CANYON BLVD 4FT± N OF S SIDE PVMT 45FT± NW OF PP NO 1085812E 82FT± NE OF PP NO 880862E MKD (C-8B)	SY 5371
MALIBU (1960)	28.753	USC+GS MON ON TOP CONC POST PACIFIC COAST HWY + TOPANGA CREEK @ SE COR OF CONC BRIDGE OUTSIDE OF E END OF GUARD RAIL MKD (P-99, 1933)	SY 5372
MALIBU (1960)	28.750	CS TRAVERSE MON IN WELL PACIFIC COAST HWY @ TOPANGA CN BRIDGE 11FT± S OF S EDGE MAC PVMT 103FT W L+T CB S SIDE BRIDGE MKD (N-72)	SY 5373
MALIBU (1960)	21.334	CS TRAVERSE MON IN WELL PACIFIC COAST HWY 380FT± E TUNA CANYON RD 3FT± S OF EDGE OF MAC PVMT 20FT± NW OF NW COR OF HSE NO 18976 MKD (TCB-8A)	SY 5374
MALIBU (1960)	20.383	CSBM MON N EDGE PVMT PACIFIC COAST HWY FRONT OF HSE NO 19214 80FT± NW PP NO 770783E + 89FT± NE OF PP NO 1027877E	SY 5375
MALIBU (1960)	21.779	CS BR DISC CTR N HDWL PACIFIC COAST HWY @ BRIDGE OVER PENA CANYON + 25FT SE ENT HSE NO 19355	SY 5376
MALIBU (1960)	21.629	USC+GS MON SE COR ANG HDWL CULV PACIFIC COAST HWY 0.6MI± W TUNA CYN RD + 165FT± W OF ENT TO BUDWOOD RANCHO (HSE NO 19453) MKD (L-576 1939)	SY 5377
MALIBU (1960)	27.048	CS TRAVERSE MON IN WELL 29FT± N C/L PACIFIC COAST HWY 1.3MI± W OF TOPANGA CREEK BRIDGE 8FT± N OF N EDGE OF THE MAC PVMT 164FT± E CATCH BASIN ON N SIDE PACIFIC COAST HWY MKD (LAS FLORES L-8A, 1947)	SY 5378
MALIBU (1960)	26.246	CS TRAVERSE MON PACIFIC COAST HWY 1.6MI± W TOPANGA CANYON CREEK BRIDGE 3FT± S OF S EDGE OF MAC PVMT OPP CULV NO 82+76 MKD (LAS FLORES L-8A 1947)	SY 5379
MALIBU (1960)	21.130	USC+GS MON TOP N HDWL CULV NO 47+25 ON PACIFIC COAST HWY 3.7MI± W OF CASTELLAMMARE BRIDGE 1FT± W OF E END OF BRIDGE MKD (M576 1939)	SY 5380
MALIBU (1960)	24.210	CS TRAVERSE MON 3FT± N OF N EDGE PVMT PACIFIC COAST HWY 20FT E GARAGE BELONGING TO HSE NO 20705 51FT± SW TP NO 936614E MKD (LAS FLORES J-8A)	SY 5381

QUAD-YEAR	ELEV	DESCRIPTION (INCLUDE QUAD AND YEAR IN DESCRIPTION)	BM NUMBER
MALIBU (1960)	31.040	CS TRAVERSE MON PACIFIC COAST HWY 79FT± NE OF NE COR OF HSE NO 20932 52FT± E OF GUY POLE MKD (LAS FLORES I-8, 1947)	SY 5382
MALIBU (1960)	17.721	USC+GS MON TOP SE END RETAINING WALL PACIFIC COAST HWY @ LAS FLORES CANYON BRIDGE 1FT± NW OF NW END OF N GUARD RAIL CONC BRIDGE MKD (N-576 1939)	SY 5383
MALIBU (1960)	15.129	CS TRAVERSE MON IN WELL 15FT± S OF N CB PACIFIC COAST HWY 59FT± E OF E LINE OF HSE NO 21628 MKD (LAS FLORES 6-8A)	SY 5384
MALIBU (1960)	15.355	BT N CB PACIFIC COAST HWY @ COAL CANYON (CARBON CANYON) CTR BRIDGE NO 53-33	SY 5385
MALIBU (1960)	18.749	USC+GS MON 0.8FT± E OF W ANG PT IN CONC RAILING BRIDGE ON PACIFIC COAST HWY @ COAL CANYON (CARBON CANYON) MKD (B 1052 1960)	SY 5386
MALIBU (1960)	13.780	USC+GS MON CONC WK PACIFIC COAST HWY 0.8MI± W OF COAL CANYON (CARBON CANYON) 4FT± N OF NW COR HSE NO 22416 MKD (S-576, 1939)	SY 5387
MALIBU (1960)	14.926	CS BR DISC 3FT± N OF N CB PACIFIC COAST HWY @ CATCH BASIN NO A962+00 18FT± E OF SE COR BLDG NO 22775 3FT± W OF E EDGE CATCH BASIN MKD (BM 48-77A, RE 5869, 1960)	SY 5388
MALIBU (1960)	17.897	USC+GS MON CONC FLUSH 46FT± S OF S CB PACIFIC COAST HWY @ NW COR OF GATE @ ENT TO MALIBU SPORT FISHING PIER, MALIBU MKD (R-576 1939)	SY 5389
MALIBU (1960)	19.629	BT SPK PACIFIC COAST HWY + MALIBU CREEK IN CONC BRIDGE S CB 12FT W OF E END OF BRIDGE	SY 5390
MALIBU (1960)	19.418	BT SPK IN PACIFIC COAST HWY + MALIBU CREEK IN CONC BRIDGE S CB 11FT E OF W END OF BRIDGE	SY 5391
MALIBU (1960)	22.232	USC+GS MON PACIFIC COAST HWY @ MALIBU CREEK NW COR BRIDGE NO 53-32 5FT± E OF W END OF BRIDGE TOP OF GUARD RAIL MKD (C-1052, 1960)	SY 5392
MALIBU (1960)	15.292	CS TRAVERSE MON 5IN BELOW TOP OF CB ON PACIFIC COAST HWY 0.2MI± W OF MALIBU CREEK IN CTR DIVIDING STRIP 3FT± N + 5FT± S OF TAN L+T IN CBS	SY 5393
MALIBU (1960)	15.113	CSBM BR DISC N E COR PACIFIC COAST HWY @ MALIBU CANYON RD 95FT± N STREET LIGHT NO M3330 73FT± N L+T IN E CB ISLAND 41FT± E L+T E CB MKD (EC COR 5 RD 5869)	SY 5394
MALIBU (1960)	56.511	CS TRAVERSE MON 8IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY ON C/L EC 0.7MI± W MALIBU CREEK 420FT± E MALIBU CANYON RD	SY 5395
MALIBU (1960)	91.247	CSBM BR DISC CATCH BASIN CTR DIVIDING STRIP PACIFIC COAST HWY @ MALIBU CANYON RD 75FT± SW TP NO 18600Y + 82FT± SE PP NO 1045723E MKD (BM 83A RE 5869 1960)	SY 5396
MALIBU (1960)	171.807	CS TRAVERSE MON 6IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 1.0MI± W MALIBU CREEK 0.2MI± W MALIBU CANYON RD	SY 5397

QUAD-YEAR	ELEV	DESCRIPTION (INCLUDE QUAD AND YEAR IN DESCRIPTION)	BM NUMBER
MALIBU (1960)	197.870	USC+GS MON 2FT± W OF E END HDWL CULV PACIFIC COAST HWY W OF MALIBU CREEK 55FT± N OF N CB 146FT± W OF E END CTR ISLAND 85FT± E PP NO 1018783E MKD (D-1052 1960)	SY 5398
MALIBU (1960)	196.095	CS TRAVERSE MON 8IN BELOW TOP CB CTR DIVIDING STRIP ON PACIFIC COAST HWY 1.3MI W MALIBU CREEK BTN TAN L+T	SY 5399
MALIBU (1960)	175.260	CS TRAVERSE MON 8IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 1.4MI W MALIBU CREEK	SY 5400
MALIBU (1960)	137.558	CS TRAVERSE MON 8IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 1.8MI± W MALIBU CREEK @ C/L EC BTN TWO L+T	SY 5401
MALIBU (1960)	139.924	CS TRAVERSE MON 10IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 1.8MI W MALIBU CREEK 161FT± W OF EC BTN TWO TAN L+T	SY 5402
MALIBU (1960)	159.781	USC+GS MON HDWL 1FT± E OF W END CULV 44FT± N OF N CB CTR DIVIDING STRIP PACIFIC COAST HWY MKD (E 1052 1960)	SY 5403
MALIBU (1960)	175.851	CS TRAVERSE MON 10IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 2.3MI± W MALIBU CREEK 0.1MI± E PUERCO CANYON RD BTN TWO L+T	SY 5404
MALIBU (1960)	160.775	CS TRAVERSE MON 10IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 350FT± W PUERCO CANYON RD @ C/L E C BTN TWO L+T	SY 5405
MALIBU (1960)	134.149	CS TRAVERSE MON 10IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 0.4MI± E CORRAL CREEK @ C/L BC BTN TWO TAN (X)	SY 5406
MALIBU (1960)	38.398	CS TRAVERSE MON 10IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 0.5MI± W PUERCO CANYON RD 0.1MI± E CORRAL CREEK 134FT± W EC ON C/L PROD BTN TAN L+T IN CB	SY 5407
MALIBU (1960)	18.630	CS TRAVERSE MON 10IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 0.6MI± W PUERCO CANYON RD 0.5MI± E SOLSTICE CANYON RD @ BC	SY 5408
MALIBU (1960)	16.884	CSBM BR CAP FLUSH CONC WK N SIDE PACIFIC COAST HWY + CORRAL CREEK E END CONC BRIDGE NO 53-31 MKD (COUNTY SURVEYOR RE 2177 US 1303-RESET 1938)	SY 5409
MALIBU (1960)	16.882	USC + GS MON FLUSH CONC WK N SIDE PACIFIC COAST HWY + CORRAL CREEK W END CONC BRIDGE NO 53-31 MKD (F-1052 1960)	SY 5410
MALIBU (1960)	18.630	CS TRAVERSE MON 12IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 450FT± W CORRAL CREEK 0.5MI± E SOLSTICE CANYON @ C/L EC	SY 5411
MALIBU (1960)	34.207	CS TRAVERSE MON 12IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 0.2MI± W CORRAL CREEK 0.3MI± E SOLSTICE CANYON RD @ C/L BC	SY 5412
MALIBU (1960)	39.427	CS TRAVERSE MON 12IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 0.2MI± E SOLSTICE CANYON RD 3.3MI± W CORRAL CREEK	SY 5413
MALIBU (1960)	24.949	L+N 8FT± E OF W END S CONC HDWL PACIFIC COAST HWY @ SOLSTICE CREEK CONC BRIDGE MKD (TBM ELV 24.89)	SY 5414

QUAD-YEAR	ELEV	DESCRIPTION (INCLUDE QUAD AND YEAR IN DESCRIPTION)	BM NUMBER
MALIBU (1960)	30.694	CS TRAVERSE MON IN WELL 10IN BELOW SURFACE 1.5FT± S OF S CB + 15FT± E OF W END CTR ISLAND PACIFIC COAST HWY @ SOLSTICE + CORRAL CANYON RD 93FT± NE OF NE COR HSE NO 26044 MKD (G-9)	SY 5415
MALIBU (1960)	46.425	CS TRAVERSE MON FLUSH W/SURFACE 41FT± SW C/L PACIFIC COAST HWY 0.4MI± W SOLSTICE CANYON RD 0.3MI± E LATIGO CANYON RD	SY 5416
MALIBU (1960)	44.258	USC+GS MON 1FT ± E OF W END HDWL CULV 35FT± N OF N CB OF ISLAND PACIFIC COAST HWY 0.4MI± W SOLSTICE CANYON RD + 0.3MI± E LATIGO CANYON RD MKD (G-1060 1930 RESET)	SY 5417
MALIBU (1960)	91.035	LA CD TRAVERSE MON IN WELL S SIDE OF PACIFIC COAST HWY 335FT± E OF LATIGO CANYON RD 0.7MI± W OF SOLSTICE CANYON 11FT± E OF SD CULV @ HWY STA (A-723+86)	SY 5418
MALIBU (1960)	135.043	CS TRAVERSE MON FLUSH W/SURFACE 73FT± S C/L PACIFIC COAST HWY 0.2MI± W LATIGO CANYON RD 67FT± E FROM END DIVIDING STRIP @ ENT TO (GULLS WAY) HSE NO 26800 1FT± N OF N EDGE OLD HWY	SY 5419
MALIBU (1960)	120.085	CS TRAVERSE MON FLUSH W/SURFACE S SIDE PACIFIC COAST HWY 0.4MI± W LATIGO CANYON RD 46FT± S OF L+T S CB HWY DIVIDING STRIP	SY 5420
MALIBU (1960)	77.492	CS TRAVERSE MON FLUSH W/SURFACE 15FT± S OF S EDGE PVMT PACIFIC COAST HWY 0.5MI± W LATIGO CANYON RD 0.3MI± E ESCONDIDO CREEK 37FT± S L+T S CB DIVIDING STRIP	SY 5421
MALIBU (1960)	29.250	CS TRAVERSE MON C/L PROD PACIFIC COAST HWY 0.7MI± W LATIGO CANYON RD 372FT± E ESCONDIDO CREEK BRIDGE 46FT± S L+T S CB DIVIDING STRIP	SY 5422
MALIBU (1960)	17.359	CSBM BR CAP FLUSH W/SURFACE PACIFIC COAST HWY + ESCONDIDO CREEK @ N SIDE ESCONDIDO CREEK BRIDGE @ E END WK 0.8MI± W OF LATIGO CANYON RD 0.5FT± E USC+GS MON MKD (COUNTY SURVEYOR RE 2177 US 1307 RESET 1938)	SY 5423
MALIBU (1960)	17.369	USC+GS MON FLUSH @ SURFACE PACIFIC COAST HWY + ESCONDIDO CREEK @ N SIDE ESCONDIDO CREEK BRIDGE @ E END OF WK 0.8MI± W LATIGO CANYON RD 0.5MI± W CSBM MON	SY 5424
MALIBU (1960)	19.051	CS TRAVERSE MON 12IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 150FT± W ESCONDIDO CREEK BRIDGE C/L BC 71FT± W BEG DIVIDING STRIP	SY 5425
MALIBU (1960)	85.474	CS TRAVERSE MON CTR DIVIDING STRIP PACIFIC COAST HWY 0.5MI± W ESCONDIDO CREEK BRIDGE 320FT± E EC 1FT± N L+T S CB DIVIDING STRIP	SY 5426
MALIBU (1960)	103.634	CS TRAVERSE MON 12IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 0.4MI± W ESCONDIDO CREEK BRIDGE 5FT± W BC 37FT± W BEG DIVIDING STRIP	SY 5427
MALIBU (1960)	134.220	CS TRAVERSE MON 12IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 0.3MI± E PARADISE COVE 448FT± W OF BC 1FT± N L+T S CB	SY 5428
MALIBU (1960)	123.356	CS TRAVERSE MON 12IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 0.2MI± E PARADISE COVE 66FT± W OF E END DIVIDING STRIP 1FT± N L+T S CB	SY 5429

QUAD-YEAR	ELEV	D E S C R I P T I O N (INCLUDE QUAD AND YEAR IN DESCRIPTION)	BM NUMBER
MALIBU (1960)	105.698	CS TRAVERSE MON 12IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY NR ENT PARADISE COVE 35FT± E OF W END 1FT± N L+T S CB	SY 5430
MALIBU (1960)	118.884	CS TRAVERSE MON 12IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 0.3MI± W PARADISE COVE 0.5MI± E ZUMA FIRE STA 85FT± S FIRE HYDRANT 1FT± S L+T N CB	SY 5431
MALIBU (1960)	115.360	CS TRAVERSE MON 12IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 0.5MI± W PARADISE COVE 0.3MI± E ZUMA FIRE STA 47FT± E EC 1FT± S L+T N CB	SY 5432
MALIBU (1960)	130.073	CS TRAVERSE MON IN WELL 42FT± S C/L PACIFIC COAST HWY W/D ZUMIREZ DR 42FT± NW OF NW COR ZUMA FIRE STA	SY 5433
MALIBU (1960)	144.134	CS TRAVERSE MON CTR DIVIDING STRIP PACIFIC COAST HWY 0.3MI ± W ZUMA FIRE STA @ BC	SY 5434
MALIBU (1960)	161.342	USC+GS MON FLUSH S CB CTR DIVIDING STRIP PACIFIC COAST HWY 1.0MI± E ZUMA CREEK BRIDGE @ ENT MALIB RIVIERA MOTEL (HSE NO 28920) 9FT± W OF E END OF DIVIDING STRIP	SY 5435
MALIBU (1960)	196.322	CS TRAVERSE MON 39FT± NW APPROX C/L PROD PACIFIC COAST HWY 0.5MI± W ZUMA FIRE STA 0.8MI± E ZUMA CREEK BRIDGE 12FT± W PP NO 710906	SY 5436
MALIBU (1960)	200.658	CS TRAVERSE MON CONC FLUSH W/RD 39FT± N L+T N CB PACIFIC COAST HWY 24/FT± E HEATHER CLIFF RD 63FT± NW L+T BC N CB CTR DIVIDING STRIP 44FT± E TP NO 16326Y	SY 5437
MALIBU (1960)	205.882	USC+GS MON TOP CONC POST 12IN ABOVE SURFACE 59FT± N C/L PACIFIC COAST HWY + HEATHER CLIFF RD W SIDE OF ENT HSE NO 29127 16FT± FROM GP NO 899894E MKD (R-48-1928-RES 1937)	SY 5438
MALIBU (1960)	174.187	CS TRAVERSE MON 4IN ABOVE SURFACE 79FT± N APPROX C/L PACIFIC COAST HWY 0.5MI± NE ZUMA CREEK BRIDGE 17FT± S 2FT± W CHAIN LINK FENCE COR	SY 5439
MALIBU (1960)	29.903	CSBM BR CAP CONC N SIDE PACIFIC COAST HWY ZUMA CREEK BRIDGE @ E END WK MKD (STA CO SUR RE 2177 US BM 1312 RES 1938)	SY 5441
MALIBU (1960)	29.897	USC+GS MON FLUSH N SIDE PACIFIC COAST HWY @ ZUMA CREEK BRIDGE @ E END WK	SY 5442
MALIBU (1960)	21.778	CS TRAVERSE MON FLUSH 40FT± S C/L PACIFIC COAST HWY 0.4MI± W ZUMA CREEK BRIDGE 138FT± NE OF NE COR COMFORT STA NO 2470	SY 5443
MALIBU (1960)	20.145	CS TRAVERSE MON 6IN BELOW SURFACE 43FT± S APPROX C/L PACIFIC COAST HWY 0.5MI± SW ZUMA CREEK BRIDGE 230FT± E BC 31FT± E PP NO 936655E 2FT± N 2IN IP MARKER	SY 5444
MALIBU (1960)	15.351	CS TRAVERSE MON IN WELL 37FT± S APPROX C/L PACIFIC COAST HWY 3.7MI± SW ZUMA CREEK BRIDGE 74FT± E LIFEGUARD HDQTRS GARAGE HSE NO 30064	SY 5445
MALIBU (1960)	15.226	CS TRAVERSE MON 40FT± S C/L PACIFIC COAST HWY 323FT± W MORNINGVIEW DR 45FT± N OF NW COR ZUMA BEACH REST ROOM NO 2472	SY 5446

QUAD-YEAR	ELEV	DESCRIPTION (INCLUDE QUAD AND YEAR IN DESCRIPTION)	BM NUMBER
MALIBU (1960)	14.780	CS TRAVERSE MON FLUSH W/PVMT 41FT± S C/L PACIFIC COAST HWY 1.1MI± W ZUMA CREEK BRIDGE 58FT± W PP NO 817635E	SY 5447
MALIBU (1960)	7.474	CSBM BR CAP IN WELL 18IN BELOW SURFACE 162FT± S C/L PACIFIC COAST HWY 41FT± SE L+T CONC SLAB @ SE COR COMFORT STA LA CO BLDG NO 2474 + 65FT± SE L+T CONC SLAB @ SW COR SAME BLDG MKD (Z 4B RE 329)	SY 5448
MALIBU (1960)	15.768	CS TRAVERSE MON FLUSH W/PVMT 40FT± S C/L PACIFIC COAST HWY 0.4MI± E BRIDGE @ TRANCAS CYN 19FT± W PP NO 817620E	SY 5449
MALIBU (1960)	13.271	CS TRAVERSE MON FLOSH W/PVMT 39FT± S C/L PACIFIC COAST HWY 275FT± E BRIDGE @ TRANCAS CYN 25FT± E PP NO 817619E	SY 5450
MALIBU (1960)	18.616	BRONZE TABLET S SIDE PACIFIC COAST HWY @ TRANCAS CREEK BRIDGE @ W END WK MKD (R-49 1928 RESET 1938)	SY 5451
MALIBU (1960)	14.031	CSBM MON 12IN BELOW SURFACE NR INT PACIFIC COAST HWY + TRANCAS CYN RD S SIDE BROAD BEACH RD @ W END ZUMA BEACH 2FT± N BARBED WIRE FENCE + 2IN IP MARKER 44FT± W TP NO 15504Y MKD (RM Z-5 RE 329)	SY 5452
MALIBU (1960)	7.126	CSBM MON 24IN BELOW SURFACE W OF TRANCAS CREEK @ W END ZUMA BEACH 2FT± N 2IN IP ON LINE WITH BT SPK + WASHER BY ENT (TRANCAS COUNTRY STORE) MKD (Z-5 RE 329)	SY 5453
MALIBU (1960)	73.197	CS TRAVERSE MON FLUSH W/SURFACE PACIFIC COAST HWY 0.8MI± W TRANCAS CYN BRIDGE 92FT± E BC 41FT± N L+T N CB OF DIVIDING STRIP	SY 5454
MALIBU (1960)	71.839	CS TRAVERSE MON IN WELL 36FT± N APPROX C/L PACIFIC COAST HWY 0.7MI± W BRIDGE @ TRANCAS CYN 250FT± W LUNITA RD 30FT± E TP NO 16033Y	SY 5455
MALIBU (1960)	74.463	CS TRAVERSE MON 5IN BELOW SURFACE 37FT± N APPROX C/L PACIFIC COAST HWY 0.8MI± W TRANCAS CREEK 685FT± W LUNITA RD 44FT± W OF TP NO 25836Y	SY 5456
MALIBU (1960)	102.996	USC+GS MON FLUSH W/N CB DIVIDER STRIP PACIFIC COAST HWY 1.2MI± W HWY BRIDGE OF TRANCAS CREEK 153FT± N FROM NW COR MALIBU WATER CO SHED HOUSING (ENCINAL BOOSTER) @ E END GREEN CYLINDRICAL TANK 55FT± S FROM TP NO 25848Y	SY 5457
MALIBU (1960)	104.891	CS TRAVERSE MON PACIFIC COAST HWY 1.2MI± W BRIDGE @ TRANCAS CYN 45FT± S L+T S CB DIVIDING STRIP 2FT± NE 2IN IP	SY 5458
MALIBU (1960)	118.730	CS TRAVERSE MON 15IN BELOW TOP CB CTR DIVIDING STRIP PACIFIC COAST HWY 1.4MI± W BRIDGE @ TRANCAS CYN 42FT± S PP NO 26014Y	SY 5459
MALIBU (1960)	88.277	CS TRAVERSE MON 6IN BELOW SURFACE 37FT± N APPROX C/L PACIFIC COAST HWY 1.5MI± E DECKER RD 220FT± W BROAD BEACH RD	SY 5460
MALIBU (1960)	123.363	CS TRAVERSE MON 18IN BELOW SURFACE 41FT± N APPROX C/L PACIFIC COAST HWY 1.3MI± E DECKER RD 140FT± E DRWY HSE NO 32001	SY 5461
MALIBU (1960)	168.891	CS TRAVERSE MON IN WELL 14IN BELOW SURFACE 39FT± S C/L PACIFIC COAST HWY NR HSE NO 32216 + 32232 0.5± W OF P/L FENCE PROD BETWEEN HSES 11FT± N PP NO 1059757E	SY 5462

QUAD-YEAR	ELEV	DESCRIPTION (INCLUDE QUAD AND YEAR IN DESCRIPTION)	BM NUMBER
MALIBU (1960)	164.029	CS TRAVERSE MON 1FT# ABOVE EDGE RD 42FT# N C/L PACIFIC COAST HWY 25FT# W CATCH BASIN 2FT# S 2IN IP MARKER MKD (DUME POINT C-8 RESET 1957 RE 5869)	SY 5463
MALIBU (1960)	178.970	CS TRAVERSE MON IN WELL 9IN BELOW SURFACE 39FT# S C/L PACIFIC COAST HWY 0.6MI# E DECKER RD 53FT# E CTR DRWY HSE NO 32606 11FT# N PP NO 1059771E MKD (DUME POINT B-8 RESET 1955)	SY 5464
MALIBU (1960)	97.057	USGS DISC TOP CONC POST 12IN ABOVE SURFACE 87FT# S APPROX C/L PACIFIC COAST HWY 320FT# W DECKER RD 68FT# SW TP NO 1090481E MKD (R-50 1928)	SY 5465
MALIBU (1960)	130.232	CS TRAVERSE MON IN WELL 9IN BELOW SURFACE 36FT# S C/L PACIFIC COAST HWY 0.9MI# W DECKER RD 37FT# NW PP NO 1085709E MKD (ARROYO SEQUIT L-7A RESET 1955)	SY 5466
MALIBU (1960)	126.025	CS TRAVERSE MON IN WELL 39FT# S C/L PACIFIC COAST HWY 0.5MI# W DECKER RD 12FT# NE PP NO 1059900E 72FT# E OF E END STEEL GUARDRAIL S EDGE PVMT MKD (ARROYO SEQUIT L-8B RESET 1957 RE 5869)	SY 5467
MALIBU (1960)	154.460	CS TRAVERSE MON IN WELL 9IN BELOW SURFACE 39FT# N C/L PACIFIC COAST HWY 1.5MI# W DECKER RD 65FT# E SE COR CATCH BASIN MKD (ARROYO SEQUIT K-7A RESET 1955)	SY 5468
MALIBU (1960)	149.747	CS TRAVERSE MON 8IN ABOVE SURFACE IN FACE ASPHALT CB 42FT# N APPROX C/L PACIFIC COAST HWY 19FT# W SW COR CATCH BASIN CULV MKD @ARROYO SEQUIT J-7 RESET 1955)	SY 5469
MALIBU (1960)	30.962	CSBM MON FLUSH W/SURFACE 86FT# S C/L PACIFIC COAST HWY 500FT# E ARROYO SEQUIT 35FT# S PP NO 1090612E MKD (RM Z-26)	SY 5470
MALIBU (1960)	15.500	CSBM MON 4IN BELOW SURFACE 156FT# S C/L PACIFIC COAST HWY 500FT# E ARROYO SEQUIT 163FT# SE PP NO 1090613E 104FT# S OF PP NO 1090612E MKD (Z-26)	SY 5471
MALIBU (1960)	18.318	USC+GS MON IN WK FLUSH W/SURFACE S SIDE PACIFIC COAST HWY @ ARROYO SEQUIT 17FT# E OF W END OF BRIDGE MKD (Q-583 RESET 1954)	SY 5472
MALIBU (1960)	35.104	CSBM MON 6IN ABOVE SURFACE TOP SLOPE 475FT# S PACIFIC COAST HWY 0.2MI# W ARROYO SEQUIT BRIDGE 26FT# W LIFE GUARD STATION MKD (SEQUIT RM 2 1948)	SY 5473
MALIBU (1960)	22.748	USC+GS TRIANGULATION DISC FLUSH 525FT# S C/L PACIFIC COAST HWY 0.2MI# W ARROYO SEQUIT BRIDGE 25FT# FROM EDGE CLIFF ON A ROCK POINT MKD (SEQUIT 1927)	SY 5474
MALIBU (1960)	48.496	CSBM BR CAP TOP 15IN CONC POST 2IN ABOVE SURFACE 44FT# S C/L PACIFIC COAST HWY 0.1MI# W ARROYO SEQUIT BRIDGE 3FT# S OF S EDGE PVMT 24FT# E PP NO1090621E 35FT# NE DEADMAN 175FT# NE OF NE COR CHECKING STA FOR LEO CARRILO STATE BEACH MKD (ARROYO SEQUIT H-7A RESET 1957 RE 5869)	SY 5475
MALIBU (1960)	86.965	CSBM BR CAP CONC POST 6IN ABOVE SURFACE 62FT# S C/L PACIFIC COAST HWY LA CO-VENTURA CO LINE 12FT# S REDWOOD FENCE MKD (VENTURA CO LINE LA CO LINE)	SY 5476

